# HP-2 / HP-4 Indirect Installation Instructions Overview


- **NOTES**
- · All power connections should be installed according to local/national codes by a Certified Electrician.
- This installation requires proper support as each luminaire is being installed.
- DO NOT attempt to join luminaires together on the floor. Damage may result when lifted.



VIDEOS





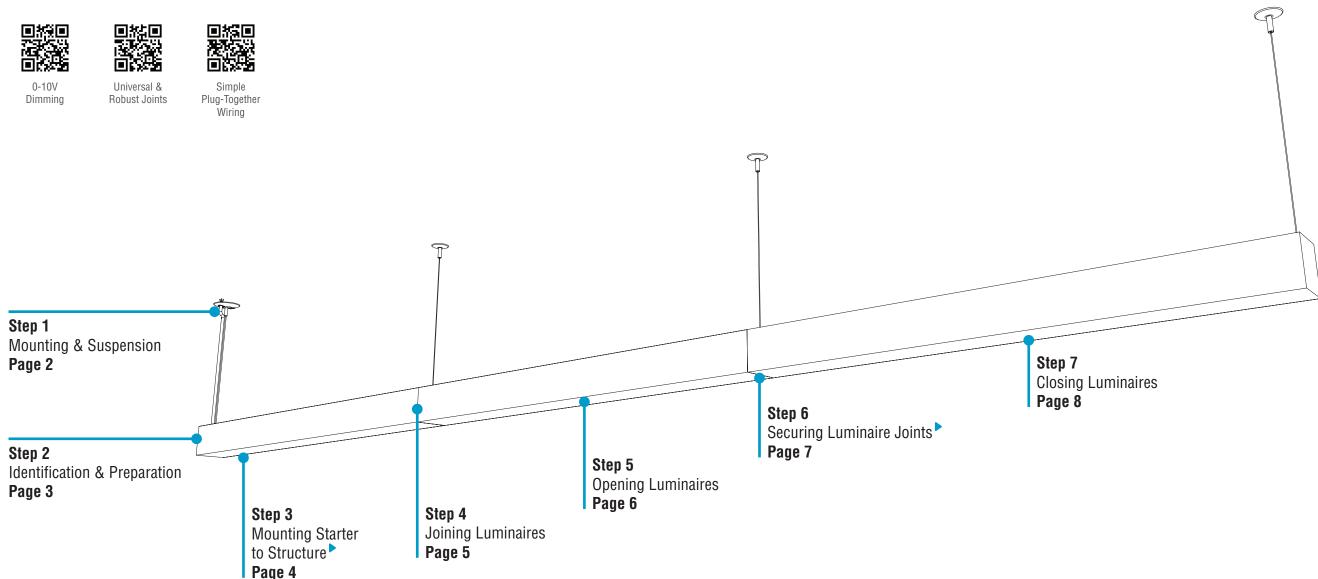



# **HP-2 / HP-4 Indirect** Installation Instructions **Step 1** - Mounting & Suspension


#### Mounting Options



- Install GridBox<sup>™</sup> and electrical conduit at feed locations.
- Install caddy clips at mounting point locations.
- All caddy clips are to be secured to structure, per local building codes.




- Install J-Box and electrical conduit at feed locations.
- Install anchor bolts at mounting point locations.
- All anchor bolts are to be secured to structure, per local building codes.
- \* Other hard surfaces include: wood, sheet metal panels, steel beams, concrete or masonry. Use hardware appropriate for each surface material type.

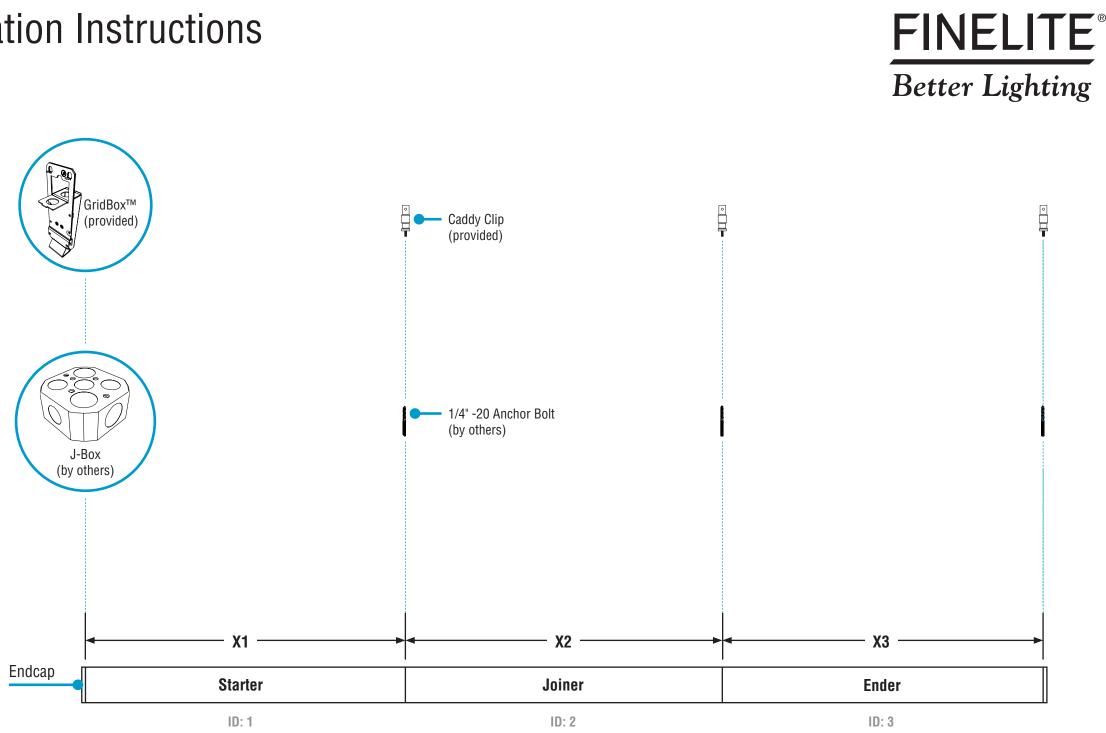




**X** = Suspension Dimensions

Refer to Record Drawings and building plans to determine exact mounting, suspension points, and power feed locations.

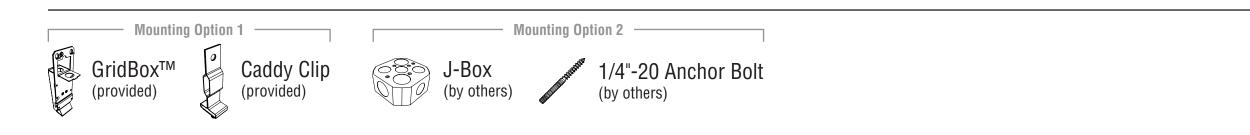

## HP-2 / HP-4 Indirect Installation Instructions Step 2 - Identification & Preparation

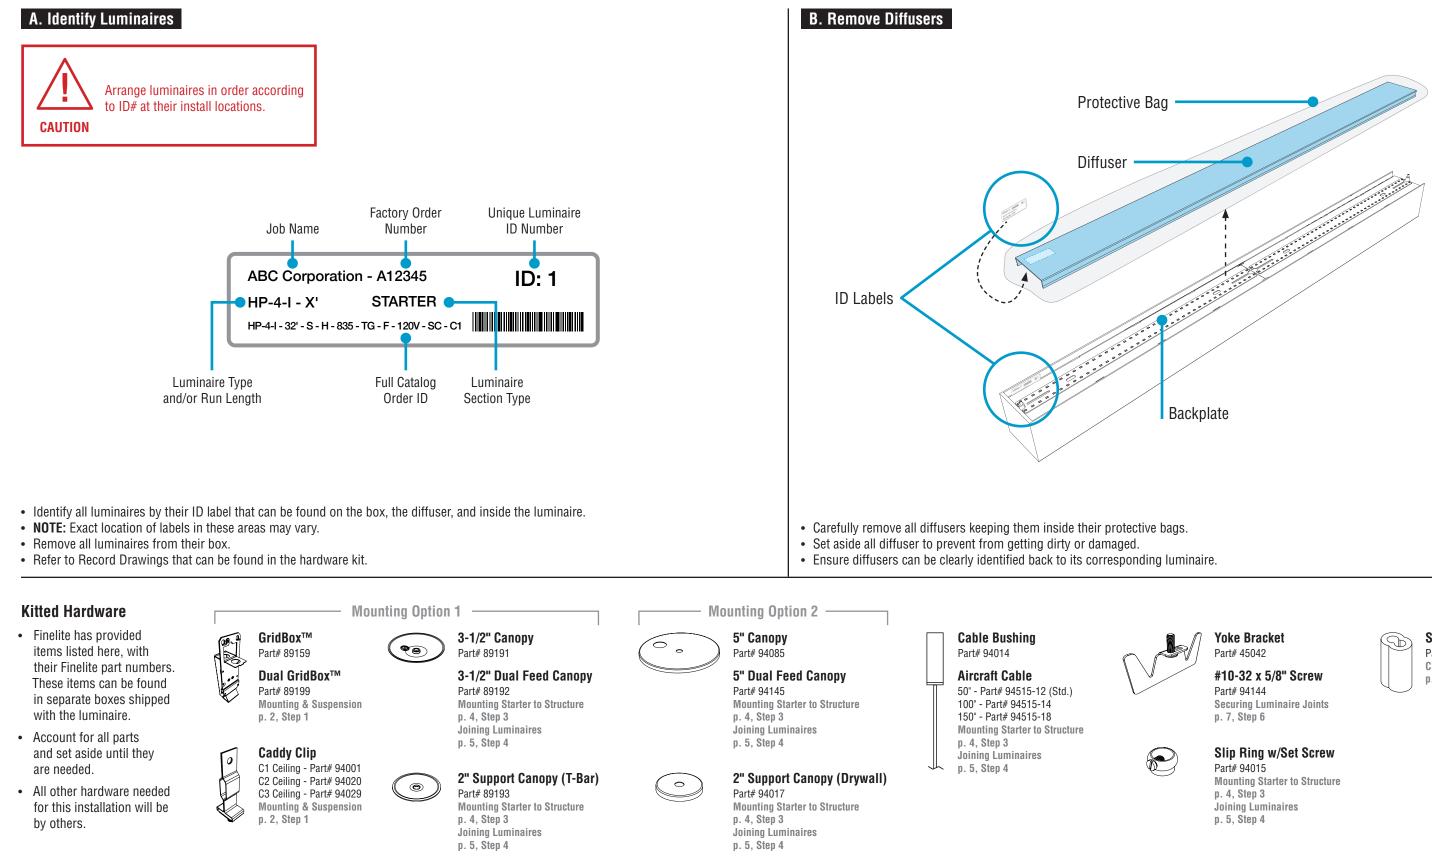




Safety Crimp Part# 94514 **Closing Luminaires** p. 8, Step 7

© 2021 FINELITE, INC. ALL RIGHTS RESERVED. Form - 98518. V4 EFFECTIVE DATE: 09/21

# **HP-2 / HP-4 Indirect** Installation Instructions Step 3 - Mounting Starter to Structure

### Mount Starter to Structure

WIRING LEGEND		
Black	Hot	Line Voltage
White	Neutral	Line Voltage
Green	Ground	
Pink	Dimming	0-10V DC
Purple	Dimming	0-10V DC

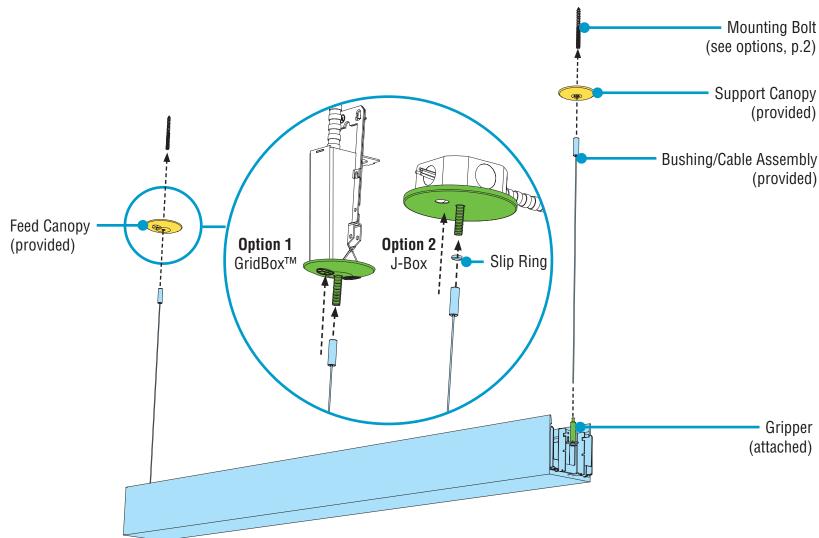

#### Mounting Option 1 - T-Bar Mounting, GridBox<sup>™</sup> with 3-1/2" Canopy (shown)

- · Slide canopy onto caddy clip bolt and thread the bushing/cable assembly onto caddy clip bolt at both mounting locations.
- While properly supporting luminaire, maneuver luminaire to ceiling.
- Feed power cord through canopy knockout and connect wires inside GridBox<sup>™</sup>.
- Locate grippers at luminaire ends and feed end of aircraft cable through it by depressing top of gripper.
- CRITICAL: If part of an independent run, perform all leveling. PROCEED TO STEP 5.

#### Mounting Option 2 - Drywall, J-Box with 5" Feed Canopy

- Slide canopy onto anchor bolt and thread the slip ring onto anchor bolt. Secure with set screw.
- Thread the bushing/cable assembly onto anchor bolt at both mounting locations.
- While properly supporting luminaire, maneuver luminaire to ceiling.
- Feed power cord through canopy knockout and connect wires inside J-Box.
- Locate grippers at luminaire ends and feed end of aircraft cable through it by depressing top of gripper.
- CRITICAL: If part of an independent run, perform all leveling. PROCEED TO STEP 5.








**Bushing/Cable Assembly** (provided)



0-10V




## HP-2 / HP-4 Indirect Installation Instructions **Step 4** - Joining Luminaires

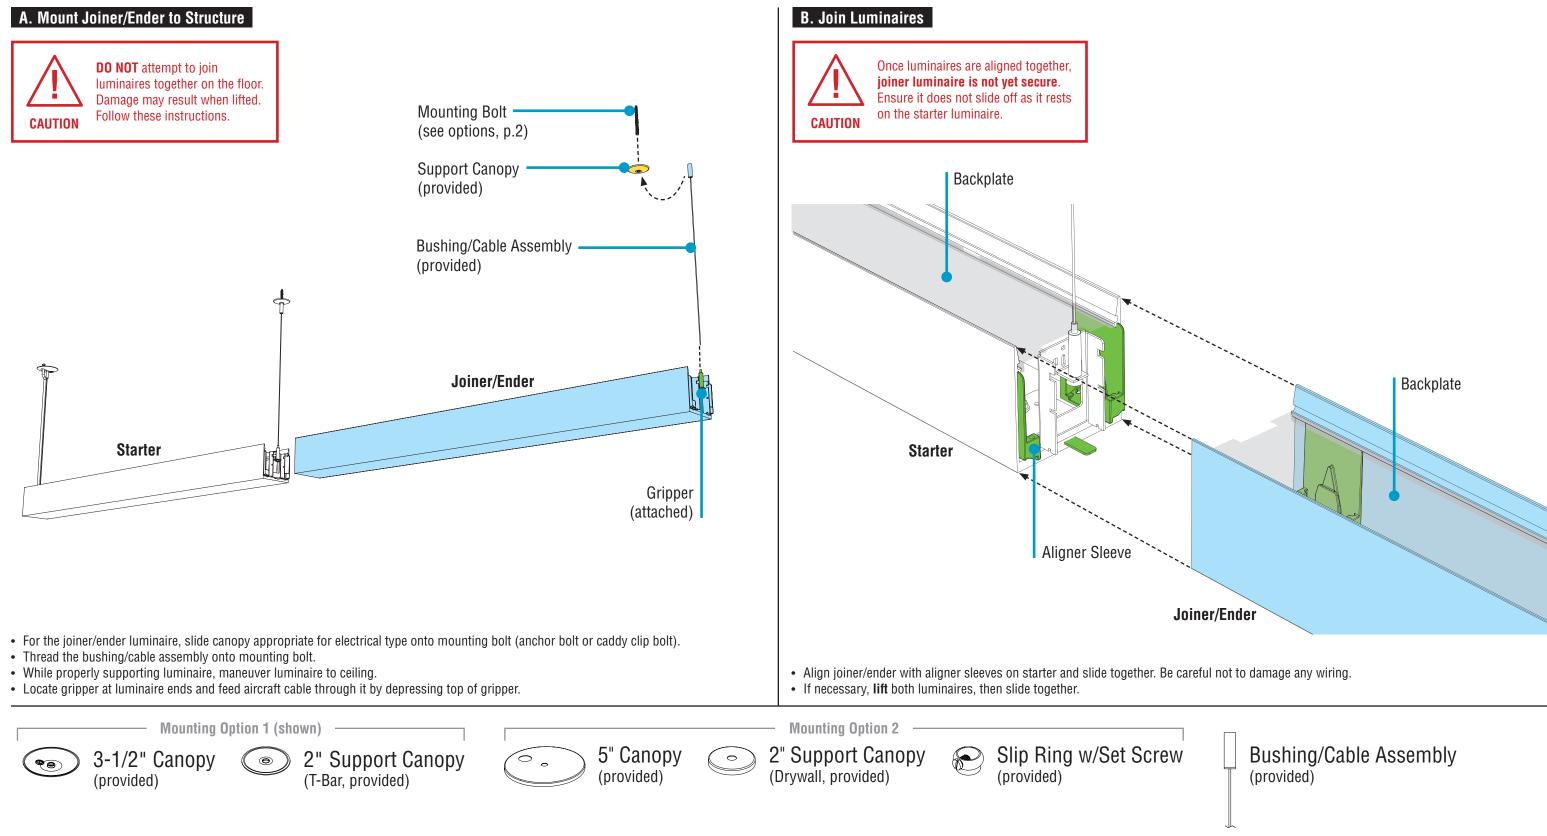



# HP-2 / HP-4 Indirect Installation Instructions Step 5 - Opening Luminaire

Release Backplates

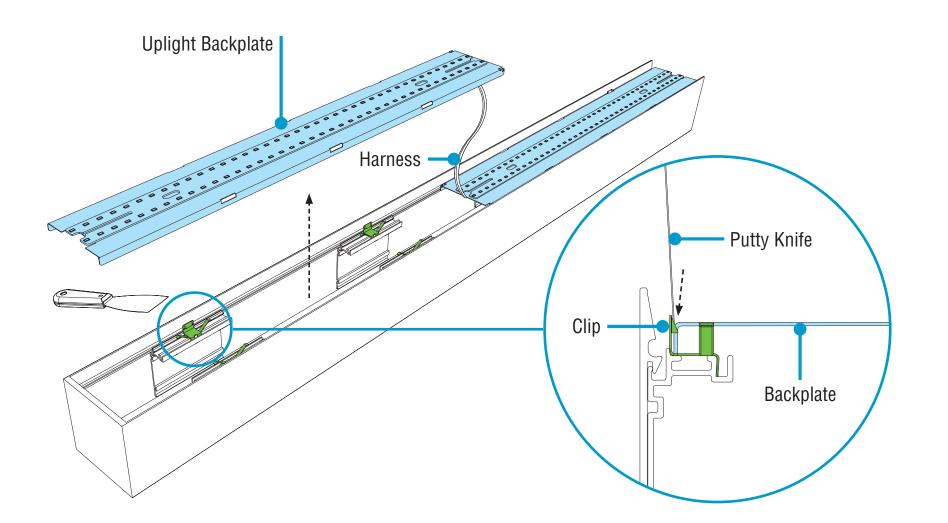


- To release backplates at joints only, use a putty knife to slip behind backplate edges and release them from clips.
- Lift backplate out of housing channel, pulling wiring harnesses through the housing.
- Let backplate rest atop of luminaire. DO NOT disconnect LED board harnesses.
  NOTE: If part of an independent section, PROCEED TO STEP 7.



## 6 of 8

## HP-2 / HP-4 Indirect Installation Instructions Step 6 - Securing Luminaire Joints

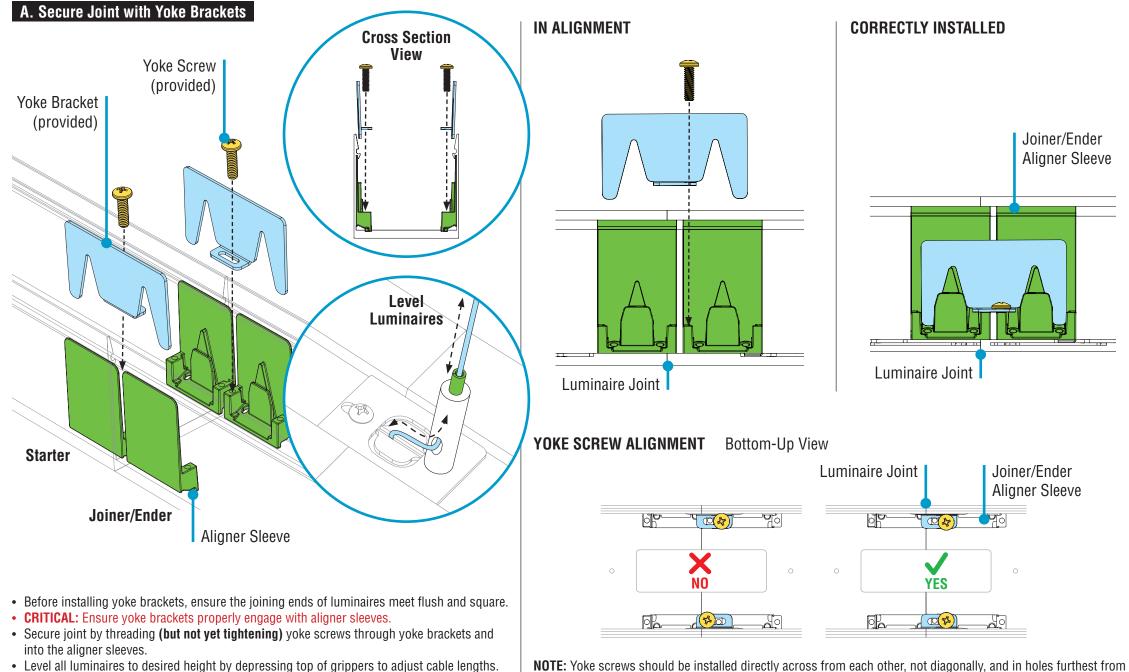


the joint line. One voke screw per one voke bracket.

Tighten voke screws<sup>1</sup> until joint seam of luminaires is closed.





## **B. Make Electrical Connections**

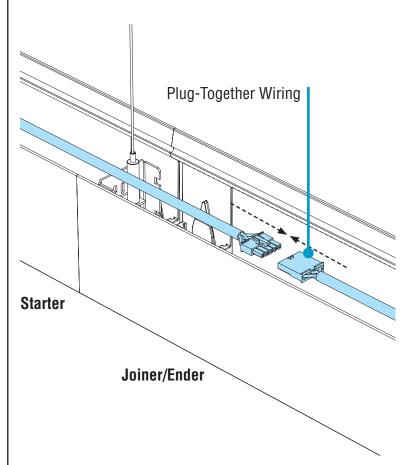

• Connect plug-together wiring.




Robust Joints



Simple Plug-Together Wiring



## HP-2 / HP-4 Indirect Installation Instructions **Step 7** - Closing Luminaires

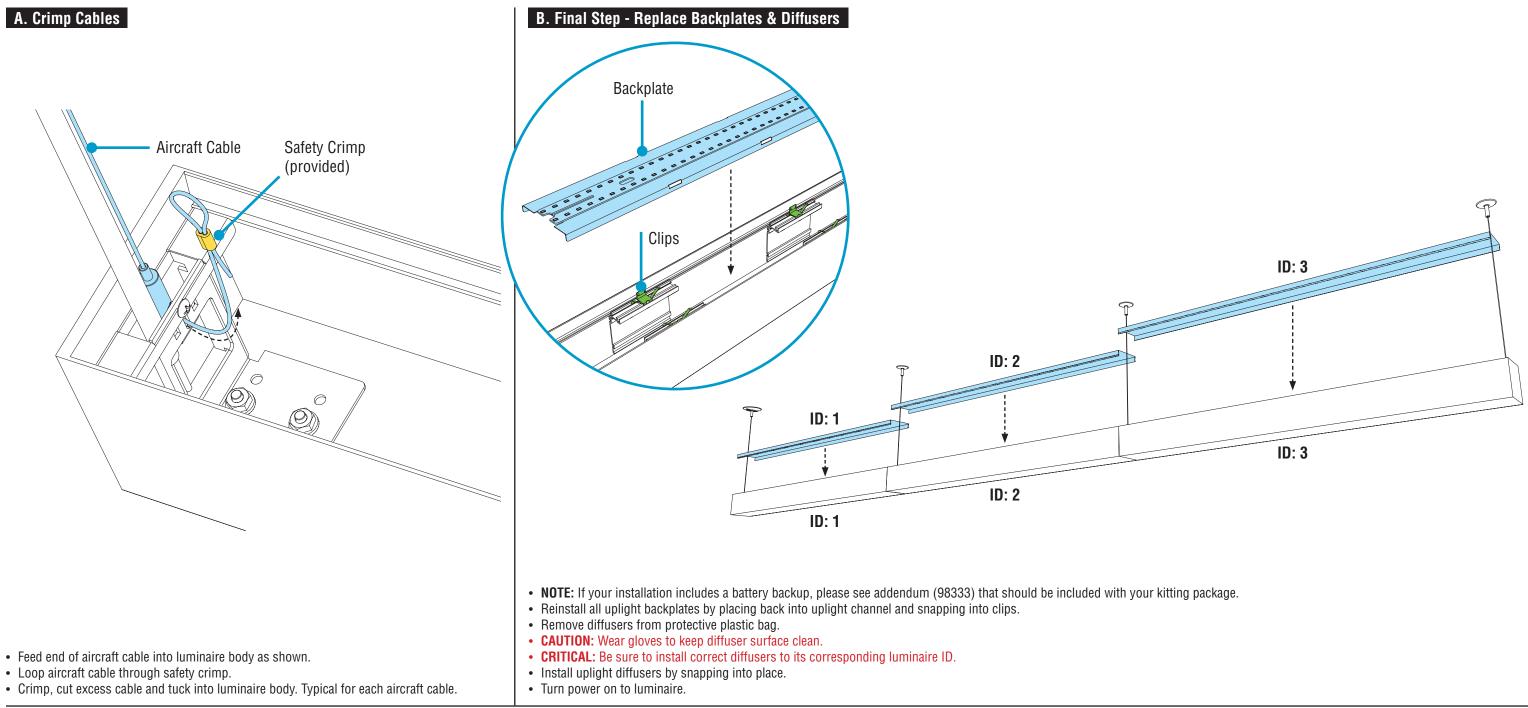

Safety Crimp (provided)

